MG / 394 cancelling MG/365

SERVICE MEMORANDUM


6 Feb. 1962

HOOD SEALING

MGA 1600

When water is found to be entering the car over the front hood stick, the following method of sealing is recommended.

- 1. Carefully remove the double-cord piping concealing the canopy tacks (Fig. 1)
- S
- 2. Increase the number of tacks securing the hood canopy to give a spacing of approximately $\frac{1}{2}$ " (12.5 mm.) as at "A" (Fig. 2).

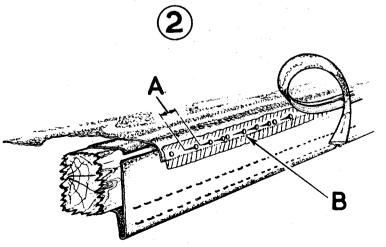

- 3. Brush on a suitable adhesive over the canopy seam $\frac{1}{2}$ " (12.5 mm.) wide as at ${}^{\dagger}B^{\dagger}$.
- 4. Take a strip of P.V.C. leathercloth material, ½" (12.5 mm.) wide, the length of hood stick and firmly seal down with adhesive directly over tacks and seams as at "B".
- 5. Replace double-cord piping.